
# PosiTector DPM Dew Point Meter

Ourdoors & Indoors



Measures and records climatic conditions including:

Relative humidity, air temperature, surface temperature, dew point temperature and difference between surface and dew point temperatures. Ideal for surface preparation as required by ISO 8502-4.

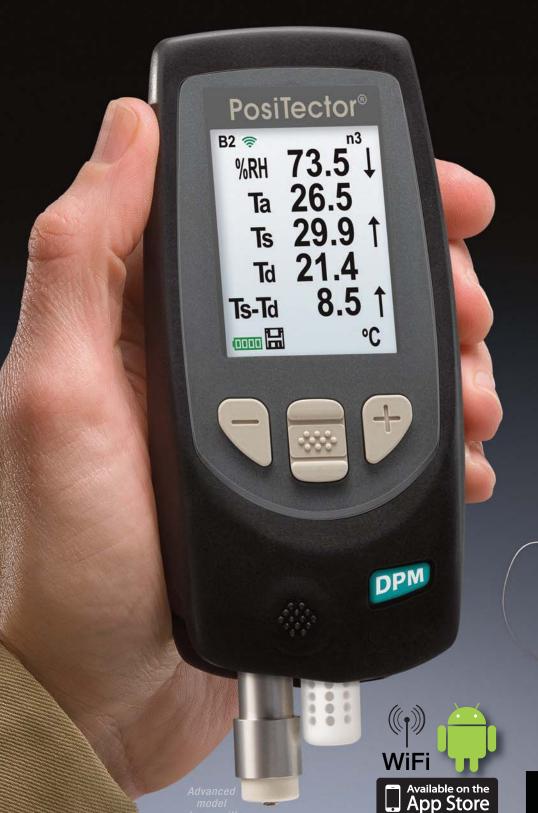

**DeFelsko**®

The Measure of Quality

## PosiTector Dew Point Meter

## A New Level of Confidence for painting contractors & inspectors.

#### Simple

- Enhanced one-handed menu navigation
- No need to consult complex tables or use a slide rule calculator
- Audio and visual alarm indicates when climate conditions are unsuitable for painting
- All readings are constantly updated and displayed simultaneously
- RESET feature instantly restores factory settings

#### **Durable**

- Rugged, outdoor/indoor instrument
- Solvent, acid, oil, water and dust resistant weatherproof
- Shock-absorbing, protective rubber holster with belt clip
- Two year warranty on body and probe

#### **Accurate**

- Fast response precision sensors provide accurate, repeatable readings with high reliability and long term stability
- Smart Trend™ indicators identify rising, falling or stable readings
- Certificate of Calibration showing traceability to NIST included
- Conforms to national and international standards including ISO and ASTM

#### Versatile

- Internal Memory stores datasets with the simple touch of a button
- Auto Log Mode automatically records 5 parameters at user selected time intervals. Ideal for unattended operation.
- Every stored reading is date and time stamped
- Field calibratable
- Celsius/Fahrenheit switchable
- Selectable display languages
- Hi Contrast backlit display for bright or dark environments
- Flip display enables right-side-up viewing
- Uses alkaline or rechargeable batteries (built-in charger)

#### **Powerful**

- Universal body accepts all PosiTector DPM, 6000, and SPG probes
- Hold function freezes the display allowing readings to be manually recorded
- USB port for fast, simple connection to a PC and to supply continuous power.
  USB cable included
- USB mass storage stored readings and graphs can be accessed using universal PC/Mac web browsers or file explorers. No software required
- Software updates via web keep your instrument current
- Connects to PosiTector.net (see far right panel)

#### 

### Gage Selection...

#### Select Standard or Advanced Features

#### **Standard Models**

#### Includes ALL features as shown on left plus...


- Monochrome display
- Storage of 2,500 datasets (RH, Ta, Ts, Td, Ts-Td). Stored readings can be viewed or downloaded
- Auto Log Mode automatically records all 5 parameters at user selected time intervals. Runs unattended on batteries for up to 50 hours or continuously via USB

#### **Advanced Models**

#### Includes ALL features as shown on left plus...

- Hi Contrast reversible color LCD
- Storage of 20,000 datasets (RH, Ta, Ts, Td, Ts-Td) in up to 1,000 batches and sub-batches. Stored readings can be viewed or downloaded
- NEW! WiFi technology wirelessly <u>synchronizes</u> with PosiTector.net, <u>downloads</u> software updates, and <u>connects</u> to mobile devices for expanded functionality
- Auto Log Mode automatically records all 5 parameters at user selected time intervals. Data can be streamed via USB or WiFi at each interval. Runs unattended on batteries for up to 8 months or continuously via USB
- On screen help, real time graphing, picture prompting, and batch notes
- Data transfer via USB to a PC or via Bluetooth Wireless Technology to a PC or printer
- User defined limits for all parameters with visible and audible warnings
- Wet Bulb temperature can be displayed
- Trend Charts graph readings in real-time

Advanced model display shown in Memory Mode with real-time graphing

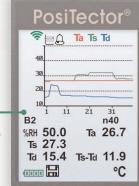

## Select from 2 Probe Styles


#### **Built-in Probe**

■ Includes built-in surface temperature sensor


#### **Separate Probe**

- Includes magnetic surface temperature sensor with armored cable.
  Ideal for unattended auto logging during work shift or at night
- Includes magnetic mount for rubber holster to attach the instrument onto steel structures
- Accepts other optional K-type sensors

### Tough Features...

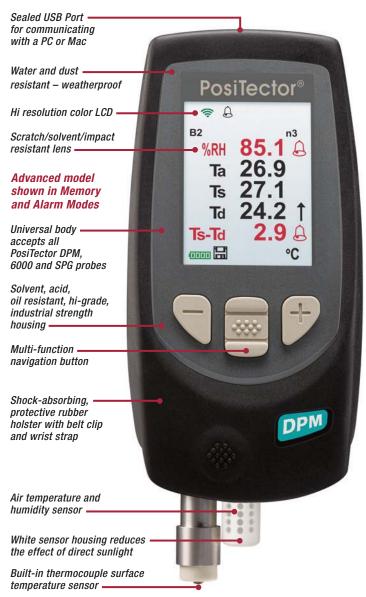

#### Example of Advanced model with Auto Log Display

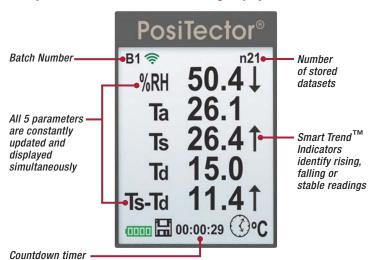





## Universal body accepts all PosiTector® **DPM**, 6000 and **SPG** probes





- Hand-held Surface Temperature Sensor for spot checking hard-to-reach surfaces
- Self-adhering Surface Temperature Sensor sticks to solid materials including aluminum, wood, concrete, etc. Ideal for unattended monitoring
- Liquid Temperature Sensor general purpose sensor with stainless steel shaft



Analyze uploaded readings using a web browser from anywhere – jobsite or head office.

#### **Accessories**

Bluetooth™ Printer receives data from Advanced models

**Rechargeable Batteries** – a set of encloop NIMH AAA batteries

AC Power Kit for continuous operation or battery charging –works in any country

**Protective Lens Shields** protect the display from overspray

Probe Style	Built-in	Separate
Ordering Guide		
Standard	DPM1	DPMS1
Advanced	DPM3	DPMS3

Specifications	Range	Accuracy	Resolution	
Surface Temperature	–40° to 80° C	± 0.5° C	0.1° C	
	80° to 190° C	± 1.5° C	0.1 0	
	–40° to 175° F	± 1° F	0.1° F	
	175° to 375° F	± 3° F	0.1 F	
Air Temperature	–40° to 80° C	± 0.5° C	0.1° C	
	–40° to 175° F	± 1° F	0.1° F	
Humidity	0 to 100%	± 3%	0.1%	

All Instruments Come Complete with humidity, air and surface temperature sensors, protective rubber holster with belt clip, wrist strap, 3 AAA alkaline batteries, instructions, nylon carrying case with shoulder strap (Built-in probe models), hard shell carrying case (Separate probe models), protective lens shield, Long Form Certificate of Calibration traceable to NIST, USB cable, two (2) year warranty.

**Size:** 159 x 61 x 31 mm (6.25 x 2.4 x 1.2 in.) **Weight:** 150 g (5.3 oz.) without batteries

Conforms to ISO 8502-4, BS 7079-B4, ASTM D3276 and US Navy NSI 009-32, IMO PSPC, SSPC-PA7 and others





**DeFelsko Corporation •** 802 Proctor Ave., Ogdensburg, New York 13669-2205 USA **Toll Free 1-800-448-3835 •** Tel: +1-315-393-4450 • Fax: +1-315-393-8471